

TiO Software Suite Release Notes

March 24, 2015

Element Software Version Numbers

Software Suite Version:	1.05
Includes:	
MC Version:	3.61
Audio Version:	2.52
Lighting Version	1.18
Android App Version:	1.0.7
iPad App Version	1.0

To see the current software versions in your system, go to Settings from the home page. The versions will be shown near the bottom.

All TiO Home application updates are obtained by downloading the new version of the app from the Google Play Store or the Apple Store.

A user can check for available TiO Element updates via the TiO app by navigating to the settings page and selecting “Check for Updates”. If an update is available for one or more TiO Elements an option to apply the updates will be presented. Selecting to apply the updates will update the MC1, which will subsequently update any other TiO Elements that are paired with the MC1.

If an MC1 update is available, the MC1 will update first, then restart. This will cause all paired Elements to disconnect and reconnect. Updates will then be applied to the Elements. Updating all Elements could take up to twenty minutes depending on the size of the system.

Updating a currently configured system will not change any of the configuration settings. All Element and Space names and Moods and Experiences are persistent through the update process.

New Features in Software Suite 1.05

1. Multiple Remote Load Assignment

Multiple lighting loads can now be assigned to a single button. This has the effect of “grouping” lighting loads so that they are controlled simultaneously from a single button push. Up to 12 separate loads can be assigned to a single button. This does not affect any other button, or the ability to control these loads individually, or group them in some other configuration on a different button.

2. Element Version Reporting

The software version of each Element is now reported on the Manage Elements screen for each individual Element. This will help in diagnosing systems, and in verifying that a software update has been completed.

3. USB Backup and Restore

A system can now be saved to, and restored from, a USB drive connected to the Master Coordinator.

4. TiO Pro Login added to System Settings Page.

An installer may now log in to the TiO Pro app (advanced settings) from the setup screen with a password.

5. General bug fixes

Known Issues in Software Suite 1.05

Audio

1. Press and Hold when Volume Assigned to button on (M)TL4
Volume must be raised and/or lowered via multiple button presses. Each press and release will raise or lower the volume 5%.
2. StreamShare
Go solo screen does not appear on the first instance
3. EQ Settings not yet functional
4. Shadows/Clones
Go solo screen does not immediately appear when clone is made. The app must be restarted for the Go Solo option to appear.
Volume of the clone is not automatically set when clone is made. Must be set manually.
5. UPnP
Working on TiO network only. Does not bridge from home owner's network. No album art.
6. Mood with Music Issue
If an AZSS1 has a stream captured as part of a Mood, quickly toggling multiple times between Moods will cause the AZSS1 to stop responding. The AZSS1 will require a reboot (remove power for 10 seconds, reapply power) to return to normal operation.
7. Bluetooth Issues
When using Bluetooth, switching to a network streaming music source and then back to Bluetooth sometimes causes Bluetooth streaming to fail. This requires a reboot of the AZSS1.

System Setup

1. Automated Pairing
When the tablet running the TiO Pro app is connected directly to the MC1 (rather than the user's network) saving the identified Elements will cause the tablet to disconnect from the MC1 when the MC1 radio resets. This will require a shutdown and restart of the TiO Pro app. When connected to the user's network, the TiO Pro connection to the MC1 is automatically restored.
2. System Registration
Functionality is currently hidden