

TiO Software Suite Release Notes

August 17, 2015

Element Software Version Numbers

Software Suite Version: 2.1.1

Includes:

MC Version:	2.11
Audio Version:	3.05
Lighting Version	1.19
Android App Version:	2.1.1
iPad App Version	2.10

To see the current software versions of the Elements in your system, access the "Manage Your Elements" page from the Main Settings page in the TiO Pro app. All Elements will be listed and the version for each is shown.

Summary: TiO 2.1.1 is a minor update that primarily addresses Streamshare bugs and the behavior of scheduled Moods and Experiences.

All TiO Home application updates are obtained by downloading the new version of the app from the Google Play Store or the Apple Store.

A user can check for available TiO Element updates via the TiO app by navigating to the settings page and selecting "Check for Updates". If an update is available for one or more TiO Elements an option to apply the updates will be presented. Selecting to apply the updates will update the MC, which will subsequently update any other TiO Elements that are paired with the MC.

If an MC update is available, the MC will update first, then restart. This will cause all paired Elements to disconnect and reconnect. Updates will then be applied to the Elements. Updating all Elements could take up to twenty minutes depending on the size of the system.

Updating a currently configured system will not change any of the configuration settings. All Element and Space names and Moods and Experiences are persistent through the update process.

New Features in Software Suite 2.1

1. **Audio** System Changes/Improvements
 - a. Minor bug fixes primarily related to the functionality of StreamShare
2. **Master Coordinator** Changes/Improvements
 - a. Minor bug fixes primarily related to the functionality of StreamShare
 - b. Increased reliability of capturing Music in Moods
 - c. Fixed bug which sometimes let the MC2 boot without properly syncing the time zone
3. **Lighting** Changes/Improvements
 - a. No Changes
4. **TiO Android** App Changes/Improvements
 - a. Minor bug fixes primarily related to the functionality of StreamShare.
5. **TiO iOS** App
 - a. No Changes

Known Issues in Software Suite 2.1.1

General

1. MC Version

This software version will operate on Master Coordinator MC2 only.

2. MC2 will reboot upon loss of Internet connection

Android App

1. User can create action group with conflicting actions

Some combinations of functions in an action group may create conflicts. In these cases, Elements may not respond, or may respond to both actions.

2. App may sometimes need to be restarted while searching for Elements

The app may not always auto-reconnect and/or refresh while searching for Elements. If the app has been connecting to Elements for more than 10 minutes, close and restart the app. Check to see that all Elements appear on the Manage Elements Screen. If not, press search again to restart the discovery process.

iOS App

1. User can create action group with conflicting actions

Some combinations of functions in an action group may create conflicts. In these cases, Elements may not respond, or may respond to both actions

2. User can only StreamShare among all AZSS1s

From the iOS app, the user will not be able to dynamically select AZSS1s for StreamShare. Activating StreamShare selects all available music streamers in the system.

3. User can enter Climate control from a space without a climate icon

The climate icon appears grayed out on spaces without climate assigned. Pressing the greyed out icon will flip to the climate control page in the app.

4. Security icon is not displayed in the action bar

Spaces that have security assigned will not display the security icon on the action bar. User must return to the home page and select security from there.

5. Icon for timed moods does not gray out immediately after disabling timed activation

Refreshing the page by navigating away and returning to the page will gray out the icon.

6. Names of Moods and Elements overlap

When user scrolls through the list of Moods, the Moods name and the Elements name may overlap on the screen

Audio

1. Press and Hold when Volume Assigned to button on (M)TL4

Volume must be raised and/or lowered via multiple button presses. Each press and release will raise or lower the volume 5%.

2. EQ Settings are not yet functional

3. List of Bluetooth device may occasionally be out of sync with actual connections.

4. Selecting the Optical Input may display a spinning wheel while audio is playing

5. UPnP

Working on TiO network only. Does not bridge from home owner's network. Album art will display if the cover image is stored in the same folder as the music and named cover.jpg.

6. Rhapsody

Not supported at this time

7. Sirius XM

Not supported at this time

8. Spotify

Not supported at this time

Lighting

1. Update procedure sometimes fails

The TL4 will automatically retry the update in 5 minutes. If the update fails 3 or more times, activate the Air Gap to power cycle the processor in the TL4.

2. TL4 Sometimes has difficulty pairing to a new MC

Pairing with a new MC when the TL4 has been previously paired with a different MC, may require manual activation of the Pairing Mode. Hold both top and bottom buttons for approximately 5 seconds until a double click is heard. After about a minute, the backlight will begin pulsing quickly, indicating that the TL4 is in Pairing Mode. Please follow the automatic association process to pair the TL4 to the new MC.

Climate

1. Climate Display Refresh

When interfacing with a Nest Thermostat, the inside temperature and Humidity displays are updated every 90 seconds.

2. No beacon support for Nest Thermostats

TiO cannot beacon a Nest Thermostat from the Manage Elements screen.

3. No beacon support for Nest Thermostats

TiO Connect

1. Honeywell Security Panel Interface

When a Honeywell/Ademco security system is initially configured, the TiO App must be restarted for the room names to appear

System Setup

1. Automated Pairing

When the tablet running the TiO Pro app is connected directly to the MC (rather than the user's network, which is the preferred method) saving the identified Elements will cause the tablet to disconnect from the MC when the MC radio resets. This will require a shutdown and restart of the TiO Pro app. When connected to the user's network, the TiO Pro connection to the MC is automatically restored.

2. System Registration

Functionality is currently hidden

3. Installer Registration/ Lookup

Functionality is currently hidden